


MultiMeter-PocketBox



Universal MultiMeter
in practical box format with
automatic range changeover

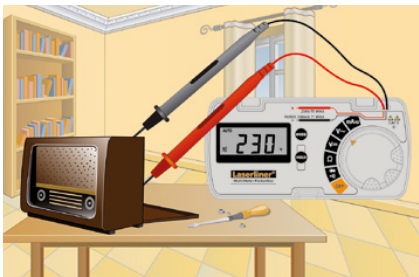

– Reliable, fast and precise **voltage, current and resistance measurement**

– **Automatic continuity tester** with acoustic signal

– **Diode test function** for determining integrity and polarity



– **Automatic function and range changeover** without reconnecting cables

– **CAT II - 250 V**

– **3 1/2 digit LCD**

– **Hold function**

– **Integrated test prods** in the box

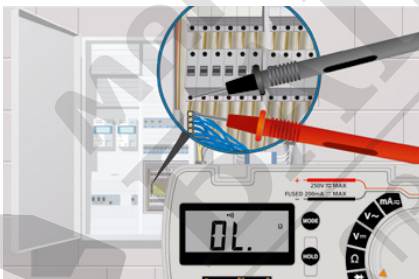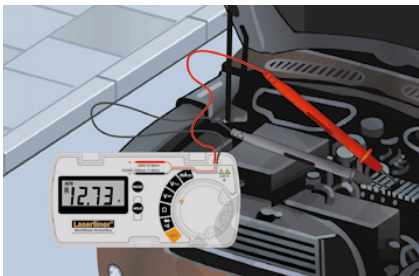

TECHNICAL DATA

VOLTAGE RANGE

V/DC:

200 mV ... 200 V, ± (0,8% + 5 Digits)

200 V ... 250 V, ± (1% + 5 Digits)

V/AC: (40 - 400 Hz)

2 mV ... 200 V, ± (1% + 5 Digits)

200 V ... 250 V, ± (1,2% + 5 Digits)

CURRENT RANGE

A/DC:

20 mA ... 200 mA, ± (1,2% + 5 Digits)

A/AC: (40 - 400 Hz)

20 mA ... 200 mA, ± (1,5% + 5 Digits)

RESISTANCE RANGE

0 Ω ... 200 Ω, ± (1,2% + 5 Digits)

200 Ω ... 200 kΩ, ± (1,0% + 5 Digits)

200 kΩ ... 2 MΩ, ± (1,2% + 5 Digits)

2 MΩ ... 20 MΩ, ± (1,5% + 5 Digits)

MAX. INPUT VOLTAGE

250 V AC/DC

DIODE TEST

open circuit voltage 1.5 V

CONTINUITY TEST

Audible signal if the resistance is < 30 Ω

INPUT RESISTANCE

> 10 MΩ (V DC, V AC)

POLARITY

Sign for negative polarity

LCD

bis 1999 (3 1/2 segments)

FUSE

250 mA/250 V, Ø 5 mm x 20 mm

OVERVOLTAGE

CAT II - 250 V

POLLUTION DEGREE

2

DEGREE OF PROTECTION

IP 40

MAX. REL. HUMIDITY

75% rH non-condensing

OPERATING TEMPERATURE

0 °C ... 40 °C

POWER SUPPLY


2 x LR44 1,5 V button cell

DIMENSIONS

113 x 56 x 23 mm

WEIGHT

(incl. batteries) 101 g

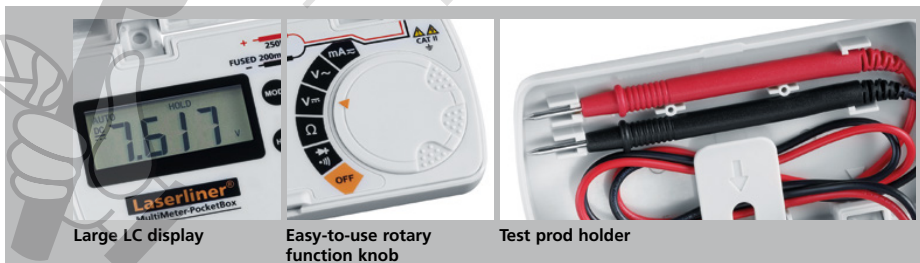

Large LC display

Easy-to-use rotary
function knob

Test prod holder



MultiMeter-PocketBox
+ batteries

Packing dimension (W x H x D)
107 x 234 x 52 mm

ARTICLE	ARTICLE NO	EAN-CODE	PU
MultiMeter-PocketBox	083.028A	4 021563 690053	5

