



AC-Check

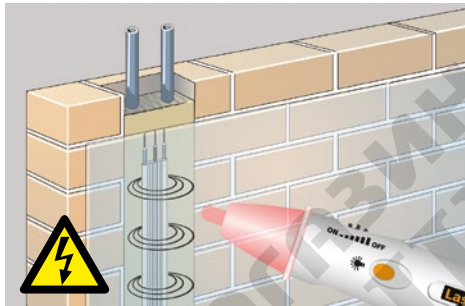

Non-contact voltage tester
with adjustable sensitivity

Rev.12.13

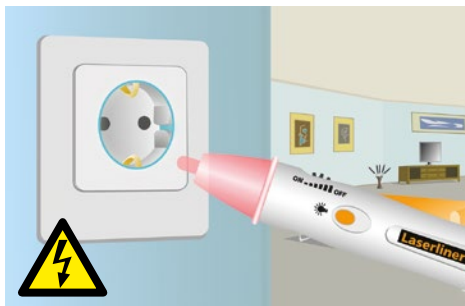

- **Contactless detection** of live lines from 5 V AC to 1000 V AC
- **Locates electrical voltages** in cables, sockets, bulb sockets and fuses
- **Determines polarity of L/N conductors**, e.g. on sockets or terminals
- **Finds breaks** in wires and cables
- **CAT III - 1000 V** – can be used for measurements throughout building installations
- **Extremely high sensitivity** for tracing lines at great depths
- **Clearly visible LED** for signalling electrical voltages
- **Super-bright, integrated flashlight** with separate ON/OFF button
- Rugged, impact-resistant **quality enclosure**

TECHNICAL DATA

INDICATOR LED, Acoustic signal

VOLTAGE RANGE
5 V/AC ... 1000 V/AC
Frequency 50 ... 400 Hz

OVERVOLTAGE CATEGORY
CAT III - 1000V

POWER SUPPLY
2 x AAA 1.5 V alkaline batteries

OPERATING TEMPERATURE
0 °C ... 40 °C

DIMENSIONS (W x H x D)
154 x 32 x 28 mm

WEIGHT (incl. batteries)
50 g



Adjustable sensitivity

Flashlight



AC-Check
+ batteries (2 x 1.5 AAA)

Packing dimension (W x H x D)

ARTICLE	ARTICLE NO	EAN-CODE	PU
AC-Check	083.008A	4 021563 687862	5

CAT III
1000V

2x
AAA

AutoSound